STATE OF THE LAKE Environment Report 2014

CROTCH LAKE







WHY WATERSHED WATCH?

A lake monitoring program of the Mississippi Valley Conservation Authority

Mississippi Valley Conservation Authority (MVCA) has long recognized the recreational and aesthetic value of lakes within the watershed and is committed to preserving and protecting water quality and fish habitat. Since the launch of the Watershed Watch program in 1998, MVCA has joined together with volunteer lake stewards throughout the watershed to take steps in restoring and protecting water quality.

Watershed Watch is an environmental monitoring and awareness program. The objectives of the program are to collect reliable environmental data to document current water quality conditions. This data is used as an essential educational tool to encourage residents to adopt sound stewardship practices aimed at




maintaining water quality. We will assist shoreline residents, both seasonal and permanent, to become personal stewards of their lake by encouraging them to take on an active role in restoring and enhancing their shorelines. In this way, we will work together to maintain healthy lake environments throughout the watershed.





ABOUT CROTCH LAKE

- Located in the Township of North Frontenac.
- Elevation of 240 metres above sea level.
- Lake perimeter is 98 kilometres.
- Deepest point is 24.2 metres.
- Warm water fishery, particularly:
 Walleye, Northern Pike, Smallmouth Bass, Largemouth Bass and, Lake Herring.
- As of 2012 there was 34 properties within 35m of the lake.

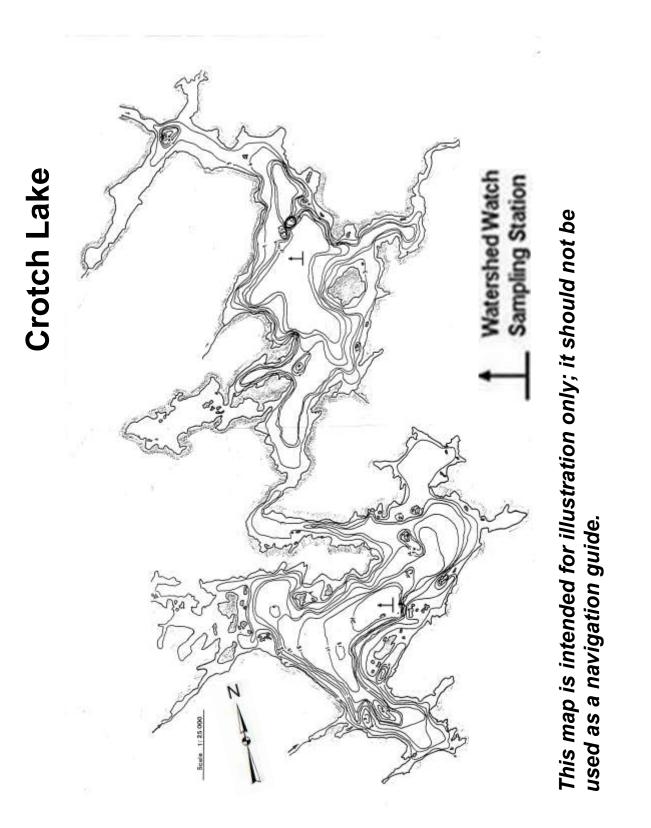

HOW DOES CROTCH LAKE MEASURE UP?

WATER QUALITY RESULTS (1975 - 2014) - CROTCH LAKE - NORTH BASIN

Sample Year	Secchi Disc	Total Phosphorus	Total Phosphorus	Chlorophyll <u>a</u>
	Depth	Euphotic Zone	1 Metre off Bottom	Composite
	(Metres)	(Micrograms/litre)	(Micrograms/litre)	(Micrograms/litre)
**1975	4.9	13.4	*12.0	3.8
1993	*6.3			
2000	4.1	9.3	10.0	1.9
2005	*3.7	*16.0	*8.7	*3.2
2010	5.2	2.7	5.0	5.0
2014	3.8	7.6	8.0	3.6
n	6	5	5	5
Minimum	3.7	2.7	5.0	1.9
Maximum	6.3	16.0	12.0	5.0
Mean	5.0	6.8	7.0	3.5
Standard Deviation	1.20	5.53	3.08	1.39

*Mean based on less than 6 measurements ** Includes Recreational Lakes Program Data. Chlorophyll <u>a</u> data prior to 1985 has been adjusted to reflect new lab procedures in filtering resulting in an increase in chla concentrations by 35%.



CROTCH LAKE

Sample Year	Secchi Disc	Total Phosphorus	Total Phosphorus	Chlorophyll <u>a</u>
	Depth	Euphotic Zone	1 Metre off Bottom	Composite
	(Metres)	(Micrograms/litre)	(Micrograms/litre)	(Micrograms/litre)
**1975	*4.9			*3.8
**1980	*5.0			*3.0
1993	6.3			
2000	4.8	3.9	8.4	1.5
2005	*4.0	*19.7	*12.7	*3.5
2010	6.7	7.3	7.0	4.9
2014	3.5	8.3	7.3	3.9
n	7	4	4	6
Minimum	4.0	3.9	7.0	1.5
Maximum	6.7	19.7	12.7	4.9
Mean	5.4	5.5	6.7	3.6
Standard Deviation	1.51	5.94	2.84	1.55

WATER QUALITY RESULTS (1975 - 2014) - CROTCH LAKE - SOUTH BASIN

* Mean based on less than 6 measurements ** Includes Recreational Lakes Program Data. Chlorophyll <u>a</u> data prior to 1985 has been adjusted to reflect new lab procedures in filtering resulting in an increase in chla concentrations by 35%.



MVCA Monitoring Staff use 4 different sampling procedures to measure water quality.

WATER CLARITY




A Secchi Disc is a black and white coloured disc used to determine water clarity. The disc is lowered into the water. The point at which you can no longer distinguish the black and white is called the Secchi depth. The higher the Secchi Disc measurement, the more clear your lake.

Lakes are classified as oligotrophic, mesotrophic, or eutrophic, depending on age and whether they have little, some, or a lot of life, respectively. Oligotrophic lakes are the youngest, mesotrophic lakes are middle-aged lakes that are less deep and more fertile than oligotrophic lakes, and eutrophic lakes (the oldest lakes) are most fertile and even more shallow than Mesotrophic lakes.

Interpreting SECCHI DISC Results				
Secchi Depth	Lake Nutrient Status			
Over 5 metres	Oligotrophic – unenriched, few nutrients			
3.0 to 4.9 metres	Mesotrophic – moderately enriched, some nutrients			
Less than 2.9 metres	Eutrophic – enriched, higher levels of nutrients			

CROTCH LAKE — ALL BASINS ANNUAL MEAN SECCHI DISC DEPTHS (metres)

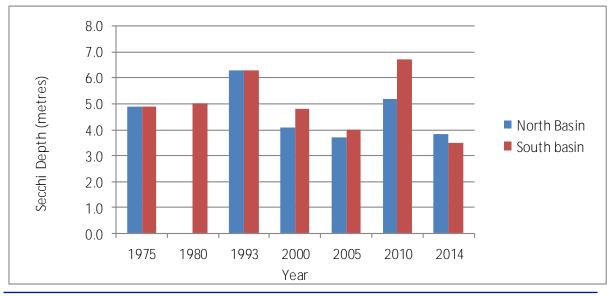

CROTCH LAKE

PHOSPHORUS LEVELS Phosphorus is


the nutrient that controls the growth of algae in most Ontario lakes. For this reason any increase in phosphorus in the lake will increase the quantity of algae that can grow. High levels of phosphorus can lead to algal blooms and in some cases affect the habitat of cold water fish such as lake trout. A general guideline exists to characterize your lake based on the total phosphorus that is measured.

A Kremmerer Bottle (pictured to the right) is used to sample water at specific depths. The bottle is lowered to the required depth with both ends open. A weight on the rope is dropped. When the weight hits the bottle it causes both




Interpreting TOTAL PHOSPHORUS Results				
Total Phosphorus Lake Nutrient Status				
10 ug/L or less Oligotrophic – unenriched, few nutrients				
11 to 20 ug/L	Mesotrophic – moderately enriched, some nutrients			
21 ug/L or more Eutrophic – enriched, higher levels of nutrients				

CROTCH LAKE - NORTH BASIN ANNUAL MEAN TOTAL PHOSPHORUS RESULTS (ug/L)

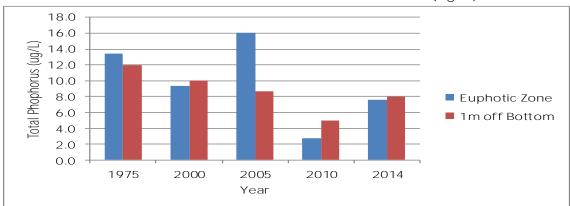

CROTCH LAKE - SOUTH BASIN ANNUAL MEAN TOTAL PHOSPHORUS RESULTS (ug/L)

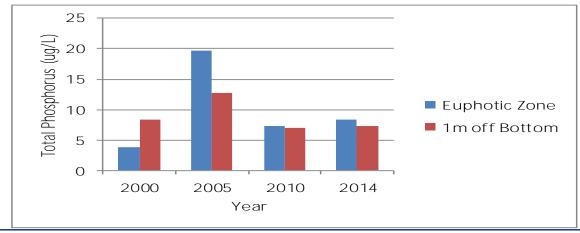

CHLOROPHYLL a


Water clarity is influenced by the amount of phytoplankton or microscopic algae present in the water. Chlorophyll <u>a</u> is the green pigment in phytoplankton.

The lower the chlorophyll <u>a</u> density in your lake, the clearer your lake is. Chlorophyll <u>a</u> is directly affected by the amount of total phosphorus in your lake. The more phosphorus there is in the water, the more algal growth will occur.



A Composite Sampler (pictured above) is used by dropping the tin container into the water. When it reaches the required depth it is slowly pulled back to the surface. The tin is filled as water enters one tube and air escapes the other. Some air remains in the tin to ensure collection throughout the haul to the surface.


Interpreting CHLOROPHYLL a Results				
Chlorophyll <u>a</u> Reading Lake Nutrient Status				
Up to 2 ug/L – low algal density	Oligotrophic – unenriched, few nutrients			
2-4 ug/L-moderate algal density Mesotrophic-moderately enriched, some nutri				
More than 4 ug/L – high algal density Eutrophic – enriched, higher levels of nutrients				

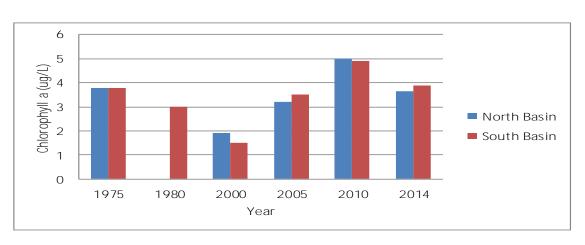

CROTCH LAKE - ALL BASINS ANNUAL MEAN CHLOROPHYLL <u>a</u> RESULTS (ug/L)

pH LEVELS

BIG GULL LAKE - EAST AND WEST BASINS 2014 pH LEVELS

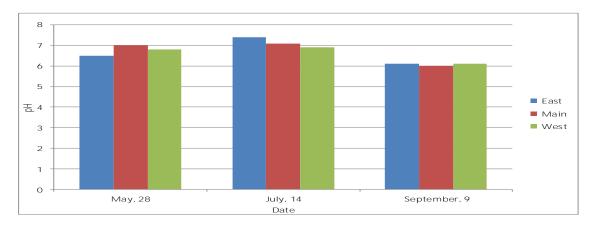

Lake with pH's lower than 7.3 are less prone to zebra mussel invasion.



Help MVCA and the Ontario Federation of Anglers and Hunters Stop the Invasion!

Crotch Lake was tested for invasive species, particularly <u>zebra</u> <u>mussels</u> and, <u>spiny water flea</u> in partnership with the Ontario Federation of Anglers and Hunters (OFAH). In 2012, Crotch lake was found to have spiny water flea but no zebra mussel veligers were found. The 2014 sampling results indicate the same findings, no zebra mussel veligers were found; however, spiny water flea were present in the samples collected.

OFAH and The Ontario's Invasive Species Awareness Program publishes a annual report on their findings available at <u>www.invadingspecies.com</u>.


Residents and property owners need to ensure that all access points to the lake have posted signs indicating the precautions that boaters and anglers can take to prevent the spread of invasive

MVCA and OFAH promote a proactive approach to invasive species management. This includes education and outreach about invasive species and how they are transported. Stop signs such as the one pictured above remind boaters to clean Inspect, Clean and Drain their boats so that they don't give invasive species a free ride.

Check and clean watercraft <u>every</u> time it is moved to a different water body!

The plankton haul net (pictured right) looks like a wind sock with a plastic cup attached to the end. The mesh size of the net is 63 microns, which can filter microscopic organisms (plankton) like spiny water flea and zebra mussel veligers from the water. The plastic cup portion of the net is called the cod end. It collects the plankton sample as water passes through the net.



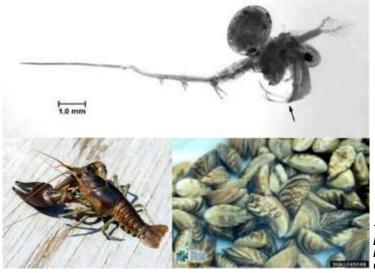

For more information on these and other invasive species, visit www.invadingspecies.com/invaders or call the Invading Species Hotline at 1-800-563-7711.

If you would like to help monitor and prevent the spread of invasive species in the Mississippi Valley watershed, email <u>monitoring@mvc.on.ca</u> or call us at 613-253-0006.


Top: Spiny water flea. Photo: Cathy Darnell Left: Rusty Crayfish. Photo: Doug Watkinson, DFO Right: Zebra mussels. Photo: Amy J. Benson, US Geological Survey.

CROTCH LAKE DISSOLVED OXYGEN SAMPLING RESULTS

Dissolved Oxygen (DO) is a dissolved form of oxygen vital for all underwater plants and animals to survive; it's what they need to breath. Adequate dissolved oxygen is important for good water quality and necessary to all forms of life. Poor (low) DO levels will cause stress on fish and may result in fish kills (mass death of a species in a season).

MVCA takes three DO readings each sample season. By monitoring the DO levels of our lakes we can develop lake profiles showing the lake stratification and the state of the lake.

Lake Stratification is the separation of lakes into three layers:

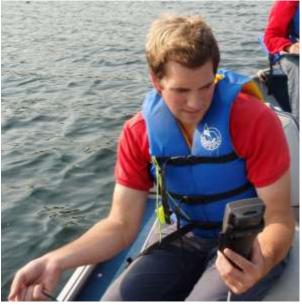

The Dissolved Oxygen Metre is used to gather DO and temperature readings. The probe is lowered into the lake and readings are taken at every metre from the hand-held screen.

Epilimnion	Warmer water with higher D.O. concentrations.		
(top layer of the lake)			
Thermocline (middle layer of the lake)	Distinct layer in which temperature changes more rapidly with depth than it does in the layers above and below.		
Hypolimnion (bottom layer of the lake)	Typically the denser and colder water at the bottom of the lake.		

CROTCH LAKE DISSOLVED OXYGEN RESULTS, SOUTH BASIN

CROTCH LAKE - SOUTH BASIN #14-15

MAY 21, 2014 at 10:30AM


Depth (m)	Temperature (°C)	Dissolved Oxygen (mg/L)	Percent Saturation	Thermal Stratification
0.1	15.2	10.95	109.0	
1	15.1	10.98	109.2	Epilimnion
2	14.5	11.15	109.4	
3	13.6	11.31	108.9	
4	12.5	11.40	106.8	Thermocline 1
5	11.8	11.27	104.0	Thermocline 2
6	10.6	10.74	96.3	Thermocline 3
7	9.7	10.63	93.5	
8	9.1	10.57	91.6	
9	8.8	10.29	88.6	
10	8.1	10.17	86.0	
11	7.5	10.12	84.4	
12	7.0	9.93	81.6	
13	6.7	9.86	80.6	
14	6.5	9.68	78.7	
15	6.3	9.88	80.1	Hypolimnion
16	6.3	9.86	79.6	
17	6.1	9.76	78.5	
18	6.0	9.67	77.7	
19	6.0	9.66	77.6	
20	6.0	9.63	77.4	
21	6.0	9.56	76.7	
22	6.0	9.50	76.3	
23	6.0	9.44	75.8	
24	5.9	9.39	75.3	
25	5.9	9.36	75.0	
26	Bottom	Bottom	Bottom	

CROTCH LAKE DISSOLVED OXYGEN RESULTS, SOUTH BASIN CONT.

CROTCH LAKE - SOUTH BASIN #14-15

JULY 4, 2014 at 10:30AM

Depth (m)	Temperature (^o C)	Dissolved Oxygen (mg/L)	Percent Saturation	Thermal Stratification
0.1	23.3	8.51	99.8	
1	23.2	8.53	99.8	
2	23.2	8.53	99.8	Epilimnion
3	23.1	8.55	99.9	
4	23.0	8.55	99.7	
5	22.9	8.40	95.4	
6	16.3	7.73	78.7	
7	13.0	7.31	69.0	Thermocline
8	10.2	7.21	64.1	
9	9.5	7.38	64.7	
10	8.8	7.41	63.8	
11	8.2	7.48	63.6	
12	7.9	7.41	62.1	
13	7.7	7.38	61.9	
14	7.5	7.35	61.1	Hypolimnion
15	7.3	7.22	59.7	
16	7.1	7.13	58.6	
17	6.9	7.20	59.3	
18	6.8	7.18	58.6	
19	6.7	6.62	54.1	
20	6.6	6.67	54.3	
21	6.6	6.43	52.3	
22	6.4	6.02	48.8	
23	6.3	5.37	5.4	
24	Bottom	Bottom	Bottom	



CROTCH LAKE DISSOLVED OXYGEN RESULTS, SOUTH BASIN CONT.

CROTCH LAKE - SOUTH BASIN #14-15

SEPTEMBER 12, 2014 at 10:50AM

Depth (m)	Temperature (^o C)	Dissolved Oxygen (mg/L)	Percent Saturation	Thermal Stratification
0.1	19.5	8.61	93.5	
1	19.6	8.55	3.2	
2	19.7	8.51	93.0	Epilimnion
3	19.7	8.48	92.7	
4	19.7	8.46	92.4	
5	19.6	8.40	91.6	
6	19.4	8.26	89.8	
7	11.6	2.66	24.1	Thermocline
8	9.8	2.83	24.9	
9	8.9	3.02	26.1	
10	8.4	3.00	25.4	
11	7.9	3.13	26.5	
12	7.7	3.10	25.9	
13	7.5	2.97	24.5	
14	7.3	2.62	21.3	Hypolimnion
15	7.1	2.31	19.0	
16	6.9	1.91	15.6	
17	6.8	1.42	11.4	
18	6.6	1.28	10.3	
19	6.5	0.97	7.8	
20	6.5	0.78	6.0	
21	6.5	0.62	4.9	
22	Bottom	Bottom	Bottom	

CROTCH LAKE DISSOLVED OXYGEN RESULTS, NORTH BASIN

CROTCH LAKE- NORTH BASIN #14-16

MAY 21, 2014 at 11:55 PM

Depth (m)	Temperature (°C)	Dissolved Oxygen (mg/L)	Percent Saturation	Thermal Stratification
0.1	16.8	10.30	106.0	
1	16.8	10.29	105.9	Epilimnion
2	16.7	10.27	105.2	
3	16.0	10.20	104.0	
4	14.9	9.94	98.4	
5	13.1	10.80	102.7	Thermocline
6	11.8	10.54	97.3	
7	10.7	10.46	94.2	
8	10.1	10.37	92.1	
9	9.6	10.35	90.7	
10	9.0	10.27	88.8	
11	8.4	10.20	86.9	
12	8.0	10.05	84.9	
13	7.6	10.04	83.9	
14	7.5	9.97	83.2	Hypolimnion
15	7.3	9.91	82.5	
16	7.4	9.95	82.8	
17	7.2	9.91	82.0	
18	7.1	9.87	81.5	
19	7.0	9.84	81.0	
20	6.9	9.73	79.9	
21	6.8	9.53	78.1	
22	6.6	8.99	73.3	
23	Bottom	Bottom	Bottom	



CROTCH LAKE D.ISSOLVED OXYGEN RESULTS, NORTH BASIN CONT.

CROTCH LAKE- NORTH BASIN #14-16

JULY 4, 2014 at 12:00 PM

Depth (m)	Temperature (°C)	Dissolved Oxygen (mg/L)	Percent Saturation	Thermal Stratification
0.1	23.9	8.21	97.3	
1	23.9	8.20	97.2	Epilimnion
2	23.9	8.18	97.0	
3	23.9	8.17	96.7	
4	23.6	8.07	94.9	
5	20.7	6.85	94.9	
6	17.3	6.32	76.4	Thermocline
7	13.6	6.70	65.7	
8	10.9	7.18	64.5	
9	9.6	7.21	64.9	
10	8.9	7.12	63.2	
11	8.4	7.04	61.4	
12	8.1	6.92	59.9	
13	7.9	6.79	58.5	Hypolimnion
14	7.7	6.67	57.1	
15	7.6	6.63	55.8	
16	7.5	6.42	53.2	
17	7.5	6.17	51.4	
18	7.4	5.52	45.8	
19	7.2	4.75	39.9	
20	Bottom	Bottom	Bottom	



CROTCH LAKE DISSOLVED OXYGEN RESULTS, NORTH BASIN CONT.

CROTCH LAKE– NORTH BASIN #14-16

SEPTEMBER 12, 2014 at 11:34 PM

Depth (m)	Temperature (°C)	Dissolved Oxygen (mg/L)	Percent Saturation	Thermal Stratification
0.1	19.5	8.63	93.9	
1	19.6	8.58	93.6	
2	19.7	8.54	93.4	Epilimnion
3	19.7	8.53	93.2	
4	19.7	8.51	93.1	
5	19.7	8.45	92.3	
6	19.5	8.03	87.0	
7	13.4	3.85	36.3	
8	10.3	3.13	27.7	Thermocline
9	9.3	2.59	22.5	
10	8.6	2.49	21.3	
11	8.4	2.15	18.0	
12	8.1	1.87	15.3	
13	8.0	1.68	14.1	Hypolimnion
14	7.9	1.58	13.4	
15	7.9	1.54	13.0	
16	7.8	1.38	11.1	
17	Bottom	Bottom	Bottom	





SEINE NETTING

Seine netting by hand is a way of sampling fish species that may live or visit the near shore areas of a waterbody. A seine net is a type of fishing net that has floats along one edge and weights along the other edge, to keep it upright in the water. It is then dragged through a section of water, encircling it, thus collecting all the fish within that area. The depth of the testing area is limited to areas wadeable by the field crew. This method has a very limited impact on the health of the fish sampled and is affordable, easy to do, and portable.



Seine netting was conducted at the boat launch sites of all the Watershed Watch lakes of the 2014 field season to help expand our knowledge of each lake beyond just its chemistry. Netting was conducted in August to avoid disturbing sensitive nesting and breeding sites.

The majority of the individual fish captured with the seine net are balt fish such as minnows and cyprinids, however some juvenile and adult game fish were also caught. Both groups (bait fish and juvenile game fish) tend to stick close to shore to avoid predation from larger fish that can be found in deeper waters. Near shore areas may also contain aguatic vegetation which is ideal camouflage for all sizes of fish that are either hiding from predators, or waiting to surprise prey, explaining why some adult game fish were caught.

It is important to note that if something was not caught in the seine we cannot conclude that the fish species is not in the lake, rather that the species was not in the sampling zone when the sampling was done.

Most stakeholder interest in fish species within a water body has to do with game fish. However, baitfish far outnumber game fish and thus play a critical role within their ecosystem and the food chain. It is important to take note of their presence, and provide them the same consideration you would for larger fish. If you are interested in learning more about baitfish, and how to identify the different species, please refer to the Department of Fisheries and Oceans Baitfish Primer. It is available online and at the MVCA office.

CROTCH LAKE SEINE NETTING RESULTS - FISH SPECIES CAUGHT

Pumpkinseed •

Bluntnose Minnow

- Bluegill •
- Yellow Perch
- Smallmouth Bass
- Banded Killifish ٠
- •
- **YOY Walleye**

SITE EVALUATION GUIDELINES

Water front development can introduce nutrients and suspended solids into surface water through migration from septic systems and runoff from cleared areas. Through lake stewardship, proper planning and education the negative effects of shoreline development on lake health can be greatly reduced.

Mississippi Valley Conservation Authority (MVCA) along with Rideau Valley Conservation Authority (RVCA) and Cataraqui Region Conservation Authority (CRCA) have released Site Evaluation Guidelines for water front property which will help to address potential impacts on the aquatic environment for the review of development proposals.

For more information on these guidelines please contact MVC at 613-253-0006.

PLANT YOUR LAND

Our free shoreline planting service helps you restore the natural look of your shoreline while combating erosion, cleaning your water and creating a healthy habitat for fish, birds and wildlife. It'll save you time and money for lawn maintenance too.

Naturalizing your shoreline does not mean you lose your view or your shore access. MVCA staff will look at your property and create a planting layout that suits your needs. The designs will maintain open areas and let you enjoy your waterfront property while gaining the benefits of naturalization.

Contact Caleb Yee by phone about planting your land at 613-253-0006 ext.253 or by email at <u>stewardship@mvc.on.ca</u>



ALGAE WATCH



Eurasian water milfoil and invasive aquatic plant that forms dense mats

Over the last decades algae and plant growth appears to be increasing in our lakes. MVCA in partnership with Friends of the Tay Watershed Association, Carleton University and Rideau Valley Conservation, are trying to better understand aquatic plant and algae growth in Eastern Ontario lakes. Phosphorus, climate change and zebra mussels are all being examined for their possible effects.

You can help us get a handle on this issue by reporting algae blooms and a excessive plant growth on your lake at <u>www.citizenwaterwatch.ca</u>.

STATE OF THE LAKE REPORT 2014



MVCA would like to thank the many dedicated volunteers and the Lake Steward Network for their assistance with and support of the Watershed Watch program.

> For more information about MVCA Monitoring Programs please call: Susan Lee at 613.253.0006 ext. 235 or email: <u>slee@mvc.on.ca</u> or visit: <u>www.mvc.on.ca</u>

> > We are located at

10970 Hwy 7 Carleton Place, Ontario K7C 3P1

